

Mounting Instructions

ValueView S-01



Supply and Display Unit
for active Torque Transducers

Options: S-02
 S-03
 S-04
 S-05
 S-06
 S-07

© ETH messtechnik gmbh

This operator manual is not a quality agreement or durability guarantee as set out in Section 443 of the German Civil Code.

Specification changes, typing and printing errors reserved.

Contents

Safety Instructions	4
1. device properties	6
1.1 Technical specifications	7
1.2 Pin assignment standard (S-01)	9
1.3 Variants and order designations	10
2. Operation and functional characteristics	11
2.1. Operation	11
2.2 Alarms / Relays	12
2.3 Analog output (option!)	14
2.4. Digital input / Zero key	15
2.4.1 HOLD function	15
2.4.2 TARA function	15
2.4.3 MIN/MAX permanent	15
2.4.4 Totaliser functions	15
2.5. Serial interface RS232 / RS485	16
3. Programming	17
4. Program number description	23
4.1 Program table	31
5. Error elimination	40
Reset to default values	41
6. APPENDIX - Non-standard variations: pin assignment	42
6. APPENDIX - Non-Standard Variations: Device Properties	44
7. Operating instructions for the special version S286	45
7.1 Description of functions	45
7.1.1 Permanent display of minimum or maximum values PN15	45
7.1.2 Instantaneous value (PN15 = 1)	45
7.1.3 Display of minimum value (PN15 = 2)	45
7.1.4 Display of maximum value (PN15 = 3)	45
7.1.5 Hold value display (PN15 = 4)	45
7.1.6 Minimum/maximum value reset PN16—	46
7.1.7 Taring PN8	46
7.1.8 Allocation of the values to the outputs PN22, 60, 70, 80 and 90	47
7.1.9 Suppressing the relay output PN65, 75, 85 and 95	47
7.1.10 Hold function	47
7.1.11 +/- full scale measurement inputs	47
7.2 Program number table special software	48

SAFETY INSTRUCTIONS

Intended Use

Please read the following safety instructions before use and keep this manual for future reference.

Intended Use

The ValueView is intended for the evaluation and display of transmitter signals (standard signals). With the switching outputs it is possible to implement simple control tasks.

Improper use or operation can result in personal injury and/or damage to property.

The final value of the transducer shown on the device display must always match the transducer used.

The device is not approved for use in hazardous areas.

Modifications and changes

The device may not be modified in terms of construction or safety without our express consent be technically modified.

Any change excludes liability on our part for any resulting damage.

In principle, the device may only be opened by qualified personnel.

Opening or dismantling the device within the warranty period will void the warranty.

Control of the device

The devices are checked before shipment and sent in perfect condition. If damage is visible on the device, we recommend a thorough inspection of the transport packaging. In the event of damage, please inform the supplier immediately.

Installation

- The ValueView may only be installed by a specialist with the appropriate qualifications, such as an industrial electronics technician or a specialist with comparable training.
- installation instructions
- There must be no magnetic or electric fields in the immediate vicinity of the device, e.g. from transformers, two-way radios or electrostatic discharges.
- The supply fuse should not exceed a value of 0.5 A slow-blow!
- Do not install inductive consumers (relays, solenoid valves, etc.) near the device and use RC spark extinguishing combinations or freewheeling diodes to suppress interference.
- Lay input, output and supply lines separately from one another and not parallel to one another. Run outgoing and return lines next to each other. If possible, use twisted-pair cables. This will give you the most accurate measurement results.
- In the case of high accuracy requirements and a small measurement signal, the sensor lines must be shielded and twisted. In principle, these should not be laid in the immediate vicinity of consumer supply lines. The shielding should only be connected to a suitable equipotential bonding (usually knife ground) on one side.
- The device is not suitable for installation in potentially explosive areas.
- An electrical connection that deviates from the wiring diagram can lead to danger to persons and damage to the device.
- Several devices should not be mounted directly one above the other or in a highly thermally insulating housing. The permissible ambient temperature can be exceeded due to the self-heating of the displays.
- The terminal area of the devices is part of the service area. Electrostatic discharges are to be avoided here. Dangerous body currents can occur in the terminal area due to high voltages, which is why increased caution is required.
- Galvanically isolated potentials within a system must be applied to a suitable point (usually earth or system ground). This reduces the susceptibility to interference from radiated energy and avoids dangerous potentials that can build up on long cables or result from faulty wiring.

Disposal


The test device can be sent back to us free of charge for disposal, complete with all cables. As soon as the test equipment is packed with you, send a message to

sales@eth-messtechnik.de.

We will then instruct our parcel service to pick it up. Unfortunately, we cannot accept parcels sent to us unannounced.

1. DEVICE PROPERTIES

- 5-digit red display (-9999...99999 digits)
- min/max value survey
- 30 point linearization
- permanent wire breakage monitoring
- optical setpoint indication
- Hold-/Tara function via keypad or digital input
- totaliser function (summation function)

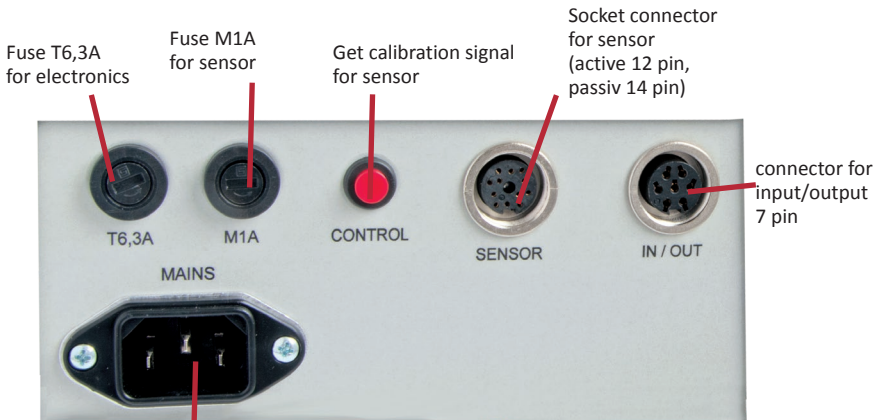

(ATTENTION: Note deviating variations in the appendix!)

1.1 Technical specifications

The ValueView supply and display device is used to display the torque and speed of ETH torque transducers.

supply voltage mains voltage	100-240 V / 50-60 Hz, $\pm 10\%$ (max. 35 VA) via IEC connector other voltages on request (For D variants at the moment only 230V as of 03.2021)			
sensor power	12V DC / 500 mA			
input voltage	Measuring range	R1	Measuring error Tu=20 to 40°C (%) MB	Digit
	± 10 V	10 M Ω	0,01	± 1
	± 5 V	10 M Ω	0,02	± 1
measurement time	Voltage	0,02 to 10,00 Seconds		
measuring principle	Sigma / Delta			
resolution	24 Bit			
memory	parameter memory EEPROM			
data retention	≥ 100 years at 25 °C			
RS485	9600 baud, no parity, 8 data bits, 1 stop bit			
line length	max. 1000 m			
Environmental conditions				
working temperature	0 to 50 °C			
storage temperature	-20 to 80 °C			
climate resistance	Relative humidity $\leq 75\%$ as an annual average without condensation			
Degree of protection	IP30			
EMC	DIN 61326			
CE mark	Conformity according to directive 2004/108/EG			
security standard	according to the low voltage directive 2006/95/EG; EN61010; EN60664-1			
measurement time	0,02 - 10,00 sec			
measurement rate	max. 50 Measurements / Second			
Rise time 0 - 100%:	0,5 ms			
Peak value measurement by pulse stretching	20 ms $\approx 98\%$; 100 ms $\approx 90\%$ (with two consecutive 5 ms pulses)			
Delay until output „0“	100 - 0 % max. 3 s			
signal output				
torque	looped through by the sensor			
rotation speed	looped through by the sensor			
limit outputs	Changeover contact 30 VDC / 2 A with resistive load			
connection				
input (12 pin)	on the back by round plug			
output (7-pin)	on the back by round plug			

Dimensions	185 x 87 x 208 mm (B x H x T)
weight	approx. 1100 g
screen	seven-segment LED, digit height 14 mm, 5 digits,
segment color	red
display area	-9999 to 99999 (comma freely selectable)
switching points:	4 switching points with 1 LED each
overflow	horizontal bar above
underflow	horizontal bar above
display time	0,1 to 10 seconds

Output (Option)

Relais	changeover contact 30 V DC / 5 A with resistive load
switching	0,5 x 10 ⁵ at maximum contact load 5 x 10 ⁶ mechanically Separation according to DIN EN 50178 Characteristics according to DIN EN 60255

Interface (Option)

RS232 (optionally galvanically isolated)	9600 Baud, no Parität, 8 Databit, 1 Stopbit
cable length	max. 3m
protokol	manufacturer-specific ASCII


Safety notice:

Please read the following safety instructions before installation and keep this guide for future reference.

1.2 Pin assignment standard (S-01)

(ATTENTION: Note the deviating variations in the appendix - from page 42!)


12-pin connector

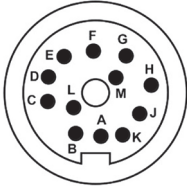

(coupling socket - female-
seen from the front
)

Pin	Signal
A	NC
B	Angle track
C	Moment
D	Moment mass
E	Supply + angle ground
F	Supply 12 V
G	Angle track A
H	NC (reserved)
J	NC (reserved)
K	Control entrance
L	NC (reserved)
M	NC (reserved)


7-pin connector

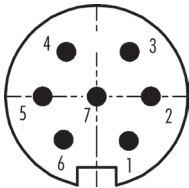


(coupling socket - female-
seen from the front)

Pin	Signal
1	Speed output (looped through)
2	+12 V
3	Mass torque
4	Moment output
5	Moment mass
6	Control entrance
7	Taring

Torque analog output, direct out-
put from torque sensor, untared.

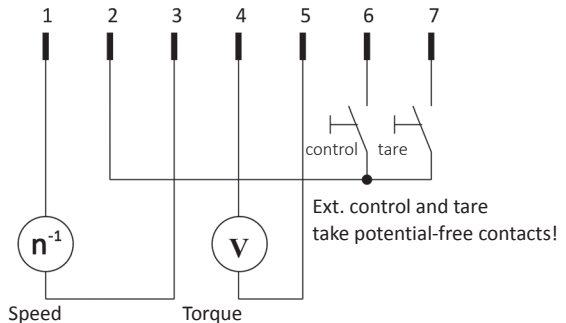

1.3 Variants and order designations

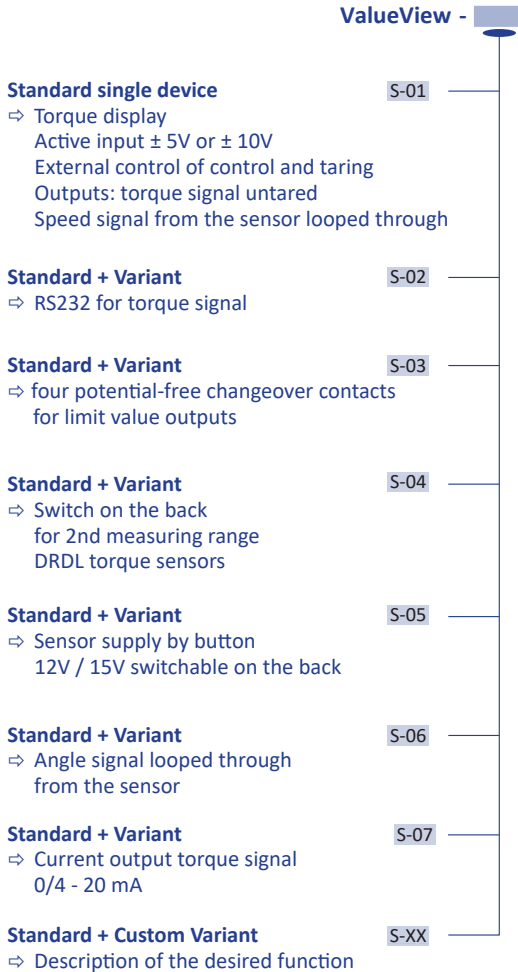









2. Operation and functional characteristics

2.1. Operation

Attention: The following programming manual describes some functions that are not possible in the ValueView. The indicator is intended for torque indication.

Not possible are e.g. Position detection, temperature, resistance, current, etc.

As an option, relay outputs, analogue output, RS232 are available.

Display (1)	
7 segment display	5-digit, red
Digit height	14 mm
Display range	-9999...99999
Decimal points	none, 1, 2, 3, 4 (adjustable)
Physical unit	°C, °F, Pt100 / Thermocouple
Setpoint displays (2)	
Optical threshold message	4 LED, red
Keys (5), (6), (7), and (3)	
	Programming mode
	Increase of value range
	Decrease of value range
 + 	Address Next lower program number
 + 	Address Next higher program number
	Activation of TARA or HOLD, Reset for MIN/MAX permanent
Dimension gap (4) for physical unit	
Variable dimension strip	Dimension on demand e.g. kg, m³...

Switching on

Before switching on, check all the electrical connections to make sure they are correct. On completion of the installation, the device can be switched on by applying the supply voltage.

Starting sequence

During the switching-on process, a segment test is performed for approx. 1 second, whereby all LED on the front (including setpoint LED) are triggered. After this, the type of software is indicated for approx. 1 second and then, also for 1 second, the software version. After the starting procedure, the unit changes to operation/display mode.

MIN/MAX memory

The measured minimum and maximum values are saved in a volatile memory in the unit and get lost when the unit is switched off.

You can call up the contents of the memory by pushing (less than 1 second) the [▲] or [▼] key. The relevant value is indicated for approx. 7 seconds. By briefly pressing the same key again, you will return immediately to the display mode .

[▲] ⇒ Display of MAX value

[▼] ⇒ Display of MIN value


Erase the value shown in the display by simultaneously operating the [▲] and [▼] keys. The erasure is acknowledged by horizontal bars. The content of the memory will be lost with switching-off of the device.

Overflow / Underflow	
Overflow	An overflow of the display is indicated by horizontal bars at the top of the 7-segment display.
Underflow	An underflow of the display is indicated by horizontal bars at the bottom of the 7-segment display.

2.2 Alarms / Relays


With the aid of the LED next to the 7-segment display, you can view the switching state of the relays. An active relay is indicated by the relevant LED lighting up.

Functional principle of alarms / relays	
Alarm / Relay x	Deactivated, instantaneous value, MIN value, MAX value, Hold value, sliding average value, totalizer value
Threshold	Threshold / Switch-over threshold
Hysteresis	Width of window between switching threshold
Working principle	Operating current / quiescent current
Switch-on delay	Time between reaching the threshold and the resultant switching on of the relay.
Switch-off delay	Time between reaching the threshold and the resultant switching off of the relay.
Alarm confirmation	Switch-on or switch-off interlock and rejection at activated digital input or zero key

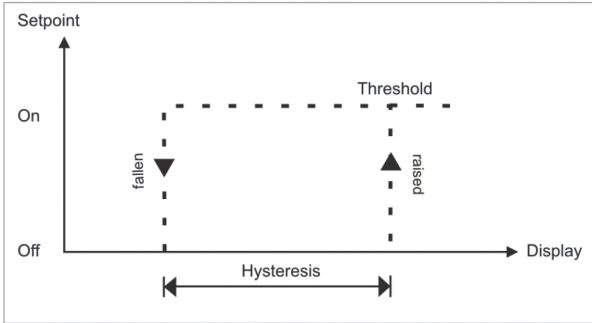


Operating current

The setpoint is **off** below the threshold and **on** on reaching the threshold.

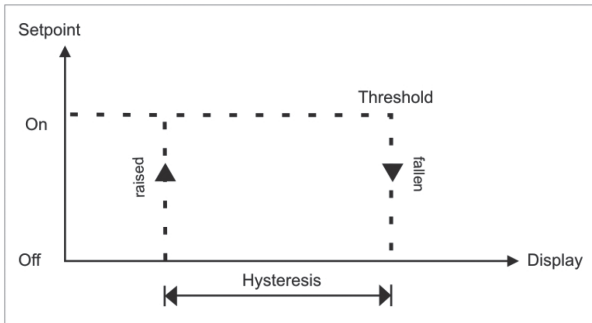

Quiescent current

The setpoint is **on** below the threshold and switched **off** on reaching the threshold.

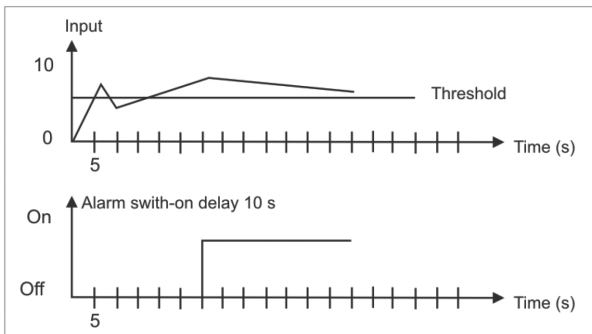

Switching-on delay

The relays S1-S4 are on 10 seconds after reaching the threshold; briefly exceeding the threshold does not lead to the relay being switched on. The switch-off delay functions in a similar manner, in other words it keeps the set point switched on until the parameterised time has elapsed.

Allocation of the alarms to a certain actuate value

As it is not always desired that alarms follow the operating mode, the outputs can be assigned to the minimum/maximum value or any other value. Therefore the adjustable value range is assigned to the according program number (PN60, PN70, PN80 and PN90).

Alarms 1-4	
Mode	Actuate value
0	none
1	instantaneous value
2	Minimal value
3	Maximal value
4	HOLD-value
5	sliding average value
6	totaliser value

Alarm confirmation

If one wants to display interim occurred alarms, the self-acting switching-on or switching-off can be blocked. Therefore the confirmation of the according setpoints 1-4 must be assigned to the digital input or the zero key under program numbers 67, 77, 87 and 97.

Caution!!! Alarm status will get lost by voltage drop!

Optical response, flashing display

If one or some thresholds are broken, the flashing of the alarm LED can amplify the optical response by assignment of the threshold PN59 to the 7 segment display.

Example:

The threshold for flashing of the display is set at setpoint 2.

If setpoint 1 is exceeded and set point 2 is not, the set point LED 1 lights up permanently.

If setpoint 2 exceeds the threshold, the 7-segment display will start to flash, setpoint 1 will light up permanently and set point LED 2 will flash. The flashing enhances the optical response and the operator sees immediately that an important threshold has been exceeded with this unit.

2.3 Analog output (option!)

The optional analog output is used for the transduction of a measuring value, supported by a standard signal of 0...10V or 0/4...20mA. The signal selection happens under program number 23. So, PN23=0 equates to the 0-10 V signal, PN23= 1 equates to the 0-20 mA signal and PN23=2 equates to the 4-20 mA signal. The analog output is parameterised via the two program numbers PN20 final value (fullscale) and PN21 initial value (Offset). At the initial value, the value is set where the analog output transmits the minimal value (0V or 0/4mA), and with "Full scale", the value at which the output transmits its maximum (10V or 20mA).

By this means it is possible to rescale the input signal of a transducer or even to convert it into another standard signal. The analog output can be deactivated via the actuate value PN22, as well as set on the active measuring value, MIN value, MAX value, HOLD value, sliding average value or totaliser value. The analog output is updated within the cycle of the measuring time. At a high measuring rate, smaller cycle fluctuations of some milli-seconds are possible.

2.4. Digital input / Zero key

In combination with the digital input (via terminal) and/or the zero key at the front, functions like e.g. HOLD, TARA, MIN/MAX permanent or the totaliser function, can be actuated or set back. The digital input is available in combination with the option sensor supply or via an external 24 VDC signal. The zero key at the front of the device can be activated by keypress.

2.4.1 HOLD function

The HOLD function is a static signal and will be activated via the digital input or the zero key (see page 26, PN15=4). With activated HOLD the lastly given measuring value remains and is by deactivation permanently overwritten by the measuring value recording. With this function a test state can be recorded beyond a specific period, so that this device can be used for control in run production, too.

Advice: HOLD value gets lost with re-start!

2.4.2 TARA function

The TARA function can be activated by zero key, digital input or with boot-up, the display value is then on the tare value.

This function is only done once, after actuation of the desired trigger and has to be taken back befor anew alignment.

2.4.3 MIN/MAX permanent

To measure a MIN/MAX value the display can be set back by the display mode (PN15) in a way, that it only shows the minimum or maximum measured value. The value can be reset by the zero key and/or the digital input.

Advice: MIN/MAX value get lost with restart!

2.4.4 Totaliser functions

With the totaliser, the measured display value can be integrated or accumulated over a time. The accumulated time-frame depends on the preset measuring time (PN14). With this function e.g. a volume over the current discharge can be recorded. So this function is qualified for the dose of fillup quantities in conjunction with relays. The mileage section can be detected by the measured speed.

The cumulative value:

- can be parameterised on different time bases and dimensions (e.g. for volume, liter, m³, km³, ...).
- can be directed to the display and outputs as a default display value.
- can be reset by a parameterised signal as counter reset (PN185) or by the counter value (PN184).
- is saved in the device even beyond a voltage drop by long-lasting memory.
A data loss of max. 30 minutes can occur in case of a voltage drop.

2.5. Serial interface RS232 / RS485

All PU5-devices can optionally be programmed or configured via an interface. Devices of the basic type do not have an interface.

Operating mode

The interface can be operated in various modes that can be parameterised via the PN34.

PN34=0

Standard mode in which the unit only replies if called on to do so. This mode is used only for configuration. Furthermore the current measuring value can be recalled via command "A ↵".

PN34=1

Transmission mode in which the measurements are transmitted via the serial interface cyclically with the set measuring time.

The transmission mode is interrupted on receipt of "> ↵" and the unit changes to standard mode. To change back to transmission mode, the display must be restarted, either by entering the command "S ↵" or by switching the device off and on.

With the transmission mode, the display value is transmitted via the interface in ASCII format. Minus signs and decimal points are also transmitted so that the output can be displayed directly on a terminal or processed by a SPS. Zeros at the front are suppressed during transmission. With an over or underflow, the display transmits horizontal bars (hyphens) „----- ↵".

Examples: „0.00 ↵"; „-9.99 ↵"; „999.99 ↵"; „-123.45"; „----- ↵"

With the aid of this simple protocol structure, the display data can be transferred very easily to a PC etc. and further processed there. In the simplest case, a terminal program from the operating system is sufficient to store the received data in a file.


Configuration of the device via interface

For configuration the set-up tool PM-Tool can be used. As the communication is a straight point-to-point connection.

The baud rate is set to 9600 baud, with 8 databits, without parity and one stopbit . Configuration is performed by transmitting ASCII symbols.

3. PROGRAMMING

Functional diagram of programming via key pad

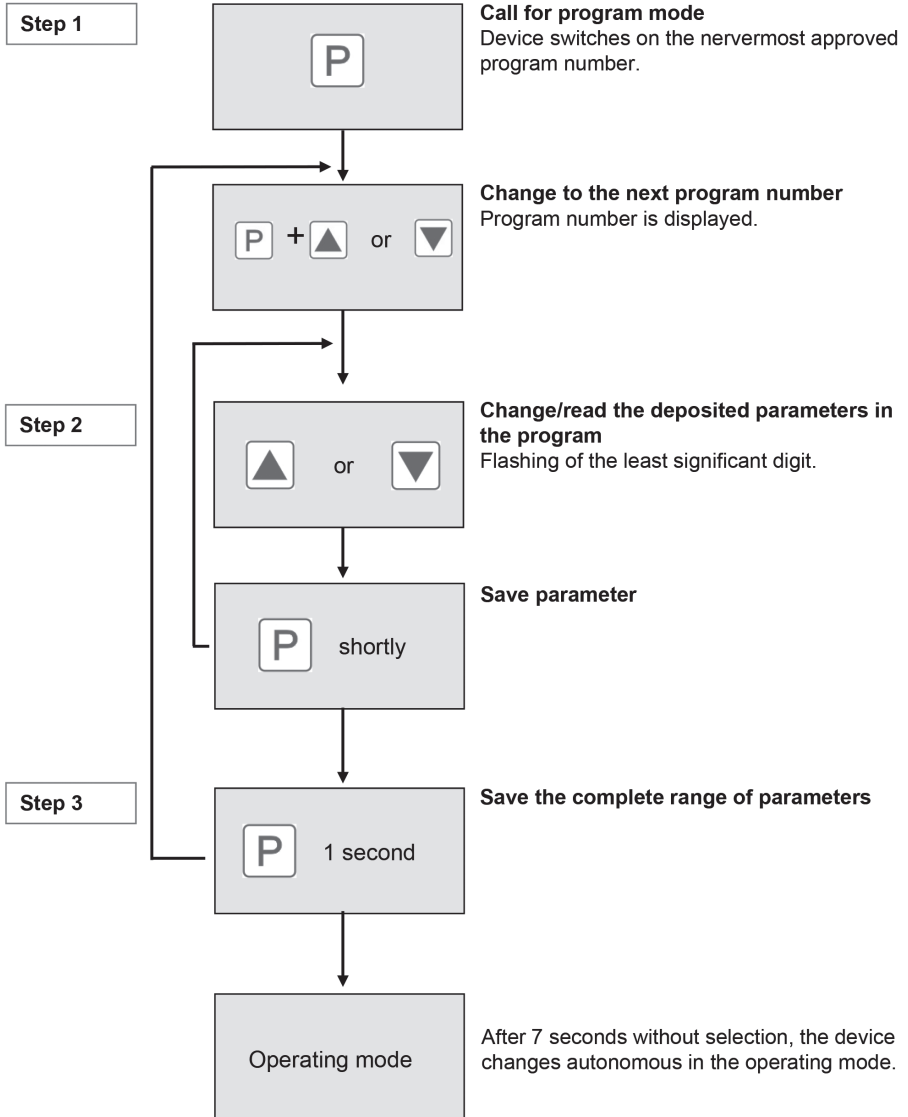

Description of the program numbers

The program numbers (PN) are shown in the display, right-justified, as a 3-digit number with a P in front of them:

Display of e.g. program number 0



Programming procedure

The entire programming of the PU5 is done by the steps described below.

Change to programming mode

Push the [P] key to change into programming mode. The unit goes to the lowest available program number. If the programming lock is activated, the key must be pushed for at least 1 second.



Change between program numbers

To change between individual program numbers, hold the [P] key down and push the [P] key for changing to a higher program number or the [▲] key for changing to a lower number. By keeping the keys pushed, e.g. [P] + [▲], the display will begin, after approx. 1 second, to automatically run through the program numbers.

Change to the parameter

Once the program number appears in the display, you can push the [▼] or [▲] key to get to the parameters set for this program number.

The currently stored parameters are displayed.

In this case, it is 75,640



Changing a parameter

After changing to the parameter, the lowest digit of the respective parameter flashes on the display. The value can be changed with the [▲] or [▼] key. To move to the next digit, the [P] key must be briefly pushed. Once the highest digit has been set and confirmed with [P], the lowest digit will begin to flash again.



Example:

The 0 is flashing this is the lowest digit and asks if you want to change it. Let us assume the figure is to be changed from 75,640 to 75,000. Briefly push the [P] key to move to the next digit. The 4 begins to flash. Change the figure by pushing [▲] or [▼] to change the digit from 4 to 0. Briefly push the [P] key to move on to the next digit. The 6 begins to flash. Change the digit by pushing [▲] or [▼] to move the 6 to a 0. Briefly push the [P] key to move to the next digit.

The 5 and 7 do not need to be changed.

Saving of parameters

All parameters must be acknowledged by the user by pushing the [P] key for one second. The changed parameters are then taken over as the current operating parameters and saved in the EEPROM. This is confirmed by horizontal bars lighting up in the display.

All the newly entered data are confirmed by the unit. If no confirmation is received, the relevant parameters have not been saved, e.g. confirmation of parameters:



Changing from programming to operating mode

If no key is pushed in the programming mode for about 7 seconds, the unit will return automatically to operating mode. Before SAVE will be displayed until the next measuring value is displayed.

Universal measuring input

The PU5 is equipped with a universal measuring input that enables the signals from all kinds of different sensors to be measured direct. So that the unit can work according to the signal generated by the sensor, the input must be configured. The basic parameter is always set under PNO .

Caution!

For the unit to function correctly, it is absolutely essential that the right sensor is parameterised under program number 0. If a wrong sensor is parameterised there, the operating behaviour may be impaired.

Setting / Calibration of the measuring input

All the units are calibrated in the factory, whereby offset and full scale have been saved for the various measuring ranges. Via terminal connections and the choice of the measuring input under PNO, different types of input signals can be worked up.

Factory calibration current / voltage under PNO = 1...12

For these parameters, new scaled display values can be allocated which are used for scaling the measurement on the display. For the offset, an input signal of 0 is assumed and for full scale, the specific full scale of the parameterised measuring range.

For parameterisation, no sensor signal has to be applied because stored values are used. Because of the differing input signals, the corresponding input configuration must be parameterised via PNO.

For the sensor signal with 4...20 mA, for example, PNO=2 has to be parameterised.

Temperature measurement PNO = 13...29

For the temperature measurement, the scaling cannot be changed by the user and is only determined from the standardized sensor range. Sensor-caused variations can be balanced by offset shift (PN5) on the characteristic line.

Sensor calibration for resistance / current / voltage PNO ≥ 3

With the sensor calibration, the unit can be calibrated or set up directly via the sensor signal or via a calibrator. For this, the measuring signal must be connected to the input of the unit. The respective display value (SCALE) must then be saved under the program number PN1 (full scale) and PN2 (offset). The sensor signal is measured via the factory parameter and displayed as current or voltage. A measurement must be started by shortly pushing the [P] key. Through this process with two calibration points, the unit is matched up with the measuring section. For more far-reaching adjustments to the characteristic line of the sensor, a linearization can be activated.

At the resistance measurement, only the display value (SCALE) is parameterised. The adjoining sensor signal (INPUT) will not be displayed, but directly absorbed unit-intern. For linearization of the parameter at least PN1 (final value) or PN2 (zero point) must be preset.

Linearization PN100

The PU5 offers the possibility to linearize, with up to 30 additional setpoints, non-linear sensors for the display of the measuring values and their subsequent processing (analog output). The number of the desired setpoints is determined under PN100. Be aware of choosing the one that makes the most sense, as it can lead to a malfunction of the device in case of no adjustment.

Approach to sensor calibration PNO => 33


To program e.g. 5 additional calibration points, 5 must be entered under PN100. Subsequently, for each of the calibration points, the voltage/current must be applied to the unit and the respective display value programmed under the following program numbers PN101 – PN105.

The sensor signal must be consistently parameterised. A gap of at least +1 digit to the previous display value must be adhered to, otherwise the input will be refused and no confirmation of the saving will be given.

Linearization of a pressure transducer for 0...100 mbar with an output of 0...20 mA. The display value before correction can be either calculated from the known characteristic line of the transducer or be determined empirically.

The non-linear range between 0...75 mbar. For calibration point 101, this means: A pressure of 15 mbar, the transducer delivers 3.3 mbar instead of the optimum value of 3.0 mbar. As 20 mA in the display corresponds to 100.0 mbar, 3.3 mA in the display corresponds to 16.5 mA before the correction.

Calibration point (PN)	Pressure (mbar)	Output Transducer (mA)	Display before correction (IN)	Desired display (OUT)
2	0	0,5	2,5	0,0
101	15	3,3	16,5	15,0
102	30	6,2	31,0	30,0
103	40	9,2	46,0	40,0
104	60	11,4	57,0	60,0
105	75	14,7	73,5	75,0
1	100	20,0	100,0	100,0

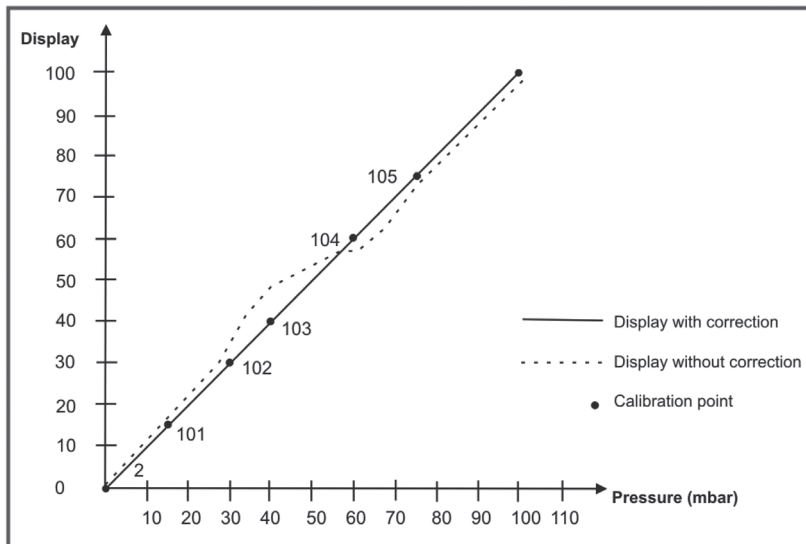

Proceeding with factory calibration PNO ≤12

With adjusted factory calibration a linearisation without connection of the sensor signal can be presetted. Therefore the number of the desired setpoints needs to be filled in under PN100, to subsequently relate the display values to a certain measuring signal.

Starting on setpoint (PN101) the display value (Scale) and subsequently the according measuring signal (Input) need to be programmed. Both inputs are saved by pushing the [**P**]-key (for approx. 1 sec).

4. PROGRAM NUMBER DESCRIPTION

The PU5 device has a default configuration ex factory, where a 0...10 V input signal is changed into a display value of 0...10000. For devices, where the preconfiguration is unknown, a reset on the default parameter should be done (see chapter 9). Otherwise unwanted reactions of the device can occur due to foreign settings.

The devices do have a digital input, with which some functions like e.g. HOLD, TARA, or MIN/MAX can be actuated.

Measuring input PNO

For the basic configuration of the unit, you must parameterise the right measuring input for your application under PNO. There is a choice of various inputs in the program number table.

Scaling PN1 and PN2

The two program numbers 1 and 2 serve to scale the display; with these two parameters, the offset and full scale are parameterised. For each setpoint there is a SCALE-value and a INPUT-value. The SCALE-value indicates the desired display value. The according measuring signal is determined by the INPUT-value. In case of factory calibration the desired current or voltage value is preset. If a sensor calibration is demanded, a measurement can be actuated by a short pushing of the [P]-key.

Before the saved current value/voltage value is visible. All inputs need to be confirmed by pushing the [P]-key for approx. 1 second; the device confirms the correct take-over with 5 vertically bars in the display.

Decimal point PN3

By changing this parameter, the position of the decimal point in the display is changed. With temperature measurements, the physical unit °C or °F can also be added.

Offset shift / Zero point shift PN5

With this parameter it is possible to carry out a parallel shift of the parameterised characteristic line. This may be necessary if, for example, a pressure sensor ages over the course of time and a shift in the zero point occurs. With the parallel shift, the sensor can be adjusted back to the zero point.

Another application would be to parameterise a certain tank level to zero and have any deviation from this level displayed.

With the offset it does not matter whether the original characteristic line has been program-med by the user with PN1, PN2 or PN101...130 or whether it is the characteristic line of a temperature sensor. The value parameterised under PN5 is added to the original display value. If, for example, a temperature sensor shows approx. 3 °C instead of 0 °C, you can compensate for this deviation by changing the value under PN 5 from 0 to -3.

If the comparison metering point is turned off for the thermocouple, the comparison metering temperature can be preset manually. This parameter can be changed directly by taring, if it has been actuated by a configured incident (see PN8).

Thermocouple reference junction PN6

The thermocouple reference junction is only available for thermocouples and can be activated or deactivated under PN6. Deactivation may be useful where the interchange point is kept at a very constant level or the temperature constitutes the direct relationship to the process. In this case the wiring to the measuring device can be conducted in simple wiring copper.

Setpoint value for taring PN7

By actuation of the taring, the display value is set on the taring value. This means the offset / zero point is shifted in a way that the display value is equivalent to the taring value.

Actuation for taring PN8

During taring, the instantaneous value is set on a demanded setpoint value, which is configured under PN7. The difference between setpoint value and actual value is saved as offset PN5 in the device. Following operational modes are known for taring, they are adjustable under PN8:

PN8 =	Actuation for taring
0	none
1	Digital input active, longer than 3 seconds
2	Zero key actuated for longer than 3 seconds
3	Digital input or zero key active for longer than 3 seconds
4	Taring at boot-up
5	Taring at boot-up and with digital input
6	Taring at boot-up and with zero key
7	Taring at boot-up, digital input and zero key
8	Taring with activated digital input for activation period
9	Fast taring on digital input
10	Fast taring on zero key
11	Fast taring on digital input or zero key

The taring can be called off by programming of the PN5 offset shift on the value zero. A special form is taring PN8 = 8: the taring is not saved in PN5 offset shift, but charged temporarily for the duration of the activated digital input. The old tara value gets lost by a boot-up. The display shows 00000 for approx. 1 second to confirm the taring. Taring is done only one time after activation of the desired activator. For a new calibration the signal for the activation of the taring must be cancelled. If the MIN/MAX value reset is programmed on the same activator as the taring, then after taring a MIN/MAX value reset takes place, too. Furthermore the taring can be watched very well as the instantaneous value is shown directly before and after taring.

Sliding average value PN12

The complete average time is a result of the product or a multiplication of time and recorded average value PN14 x PN12. If one wants to see this result in the display, the display mode PN15 needs to be programmed parallel on this result. This must be pointed out with an optional analog output or with the relays, too.

Display time PN13

The display time is the interval at which the display is updated. The longer the time between two display cycles, the calmer the display. The eye perceives a display time of 1 second as very pleasant.

Measuring time PN14

The **PU5** performs an averaging process by calculating an average from several measurements taken during the measuring time ($1/\text{measuring time} = \text{Samples/s}$). For most applications, a measuring time of 0.20 to 1.00 seconds is suitable.

Caution: The update of other functional components (analog output and relay) is carried out cyclically with the set measuring time. If the measuring time is set very short, it is possible that there will be jumps in the analog output in case of a noisy signal or a brief switching of the relay. When selecting the measuring time, it should be borne in mind that the MIN/MAX memory receives its values on the basis of the set measuring time. Should the peaks of a turbulent signal be recorded, it may certainly be worthwhile to choose a very short measuring time.

Display mode PN15

The device supports several operational modes, which are selectable under PN15.

Instantaneous value (PN15 = 1)

Operational mode „instantaneous value“ is equal to the standard display, where the last measured value is displayed.

Minimal value display (PN15 = 2)

In this operational mode, the smallest occurred display value, since the last minimal value reset, is displayed. The minimal value reset is actuated by boot-up (switching-on) or by the digital input/zero key.

Maximal value display (PN15 = 3)

In this operational mode, the largest occurred display value, since the last maximal value reset, is displayed. The maximal value reset is actuated by boot-up (switching-on) or by the digital input/zero key.

HOLD function (PN15 = 4)

If duty type HOLD was selected, the zero key and the digital input may not be occupied with other functions like e.g. trigger for taring (PN8) or MIN/MAX value reset (PN16), trigger for counter reset (PN185) or display change onto totaliser value (PN186). With setpoint confirmation (PN67, 77, 87, 97) both functions will be carried out parallelly.

Sliding average value (PN15 = 5)

The complete average time is a result of the product or a multiplication of time and recorded average value PN14 x PN12. If one wants to see this result in the display, the display mode PN15 needs to be programmed parallel on this result. This must be pointed out with an optional analog output or with the relays, too.

Totaliser value (PN15 = 6)

In operation mode „Totaliser value“, the totaliser/sum value is displayed. With this value by means of an active flow rate, a volume about the time can be collected. As this time can be very long (approx. 1 year), the value needs to be displayed in a individual adjustable dimension.

Absolute value (PN15 = 7)

In operation mode „absolute value“ the display shows the value that has been measured since voltage connection, without consideration of a previous taring.

Trigger mode (PN15 = 8)

In operation mode „trigger mode“ the instantaneous value is only transmitted on the display by a increasing shoulder via the digital input or by activating of the zero key.

Activator for MIN/MAX value reset PN16

After boot-up the MIN/MAX values are automatically set back on the instantaneous value. To set back minimum/maximum values even during operation, 3 additional escapements are available.

PN16 =	Activator for MIN/MAX value reset
0	None
1	Digital input active, for longer than 50 ms
2	Zero key pressed for longer than 50 ms
3	Digital input or zero key active, for longer than 50 ms
4	Taring function

The value reset is only shown shortly after actuation of the digital input or zero key by 5 horizontal bars (" - - - - ") for 0.5 seconds. After that the instantaneous value is shown as long in operating mode MIN/MAX value display, as the activator is taken back. This way the instantaneous value can be watched for a longer time.

If the value reset ought to be done during taring, then there is no report in the display. During value reset only the MIN/MAX value that presently shown in the display is set back!

Zero point suppression PN18

The zero point suppression offers the possibility of masking an area around zero for displaying a value of zero. In the program number the amount is parameterised which is then effective in both the positive and the negative directions. This may be necessary if, for example, a number of revolutions is being measured by an analog sensor and has a drift around zero. If the signal changes slightly when the motor comes to a standstill, a speed of zero is still indicated. In addition, slightly negative rpms are suppressed.

Analog output PN20 and PN21, PN22 and PN23

The parameters of the analogue output refer to the scaling of the display and are cyclically updated with the measuring time. With PN22 = 0 the analog output can be deactivated, whereas it remains on its initial value after a restart of the device.

The analog output can be related to all possible values that are recorded in the device. For further information please see chapter 6.3 or program number table chapter 8.1.

The initial and final value is always displayed without comma. The demonstration of the measuring value in the display is taken as base, so with a demonstration of e.g. 6.400 the final value can be parameterised by 6400 on this display value. PN23 determines the output signal either 0-20 mA, 4-20 mA or 0-10 VDC.

Interface behaviour PN34 (Option)

The current display value can be sent by the optional interface. In standard mode PN34 = 0 the display remains passive and expects data from the bus. This operation is used for the configuration of the display. For slower actions the instantaneous measuring value can be actively asked for by command. In sending mode PN34 = 1 the displays sends actively in cycle of the measuring time the current measuring value. For further information please see chapter 7 „Operation mode“.

--> Further information on this can be found in Chapter 2.5.

Security setting, user level PN50 to PN52

With the parameters in the security settings, access to the program numbers is regulated through the setting of various user levels. The user levels divide the access into various levels. The user is only given access to the settings authorised by the system operator, such as the setting of thresholds. The lower the figure for the user level given under PN52, the lower the level of security of the unit parameters against user intervention .

Userlevel PN52=		0	1	2	3	4	5	6	7	8
Access to	PN	X	X	X	X	X	X	X	X	X
Display brightness	19	X	X	X	X	X	X	X	X	X
Programming lock	50	X	X	X	X	X	X	X	X	X
Serial number 200	200	X	X	X	X	X	X	X	X	
Setpoint threshold values	61, 71, 81, 91	X	X	X	X	X	X			
Setpoint parameters	59...95	X	X	X	X	X	X	X		
Interface parameters (option)	32...34	X	X	X	X	X				
Analog output parameter (option)	20...22	X	X	X	X	X				
Measuring input parameters	0...18	X	X	X						
Linearization parameters for measuring input	100...130	X	X	X						
Authorization code	51	X								
User level	52									

User levels 1, 3, 5 and 7 are reserved user levels for which the authorization is in each case the same as the next lower level.

The parameterised user level PN52 is active as long as the authorisation code PN51 and programming lock PN50 are different. On delivery both parameters are set to 0000, so that the programming lock is deactivated.

To activate the set user level, enter a 4-digit number under PN51 as a „locking code“ and confirm it by pressing the [P]-key for approx. 1 second.

On changing to programming mode, the unit switches to the first authorised program number. If user level PN52 = 3, then, for example, the parameters of the set points can be changed, but changing the parameter of the measuring input (PN0) is not possible at this user level.

In order to obtain access to all program numbers later (equivalent to user level 0), you have to enter under PN50 the same code you used before under PN51. You must then acknowledge this by pressing the [P] key for approx. 1 second. After this you have access to all program numbers.

Caution! If the authorisation code becomes lost, the unit can be set to the default value 0000 at the manufacturer's without any data loss.

Servicing level PN53

Via this program numbers, a change between different user levels can be done. This function shall simplify the programming process, if there are no special requirements.

Simple servicing level (PN53=1, limited programming):

Designed for the standard adjustments of the device. Only program numbers which are needed to set a device into operation are displayed.

Professional servicing level (PN53=2, all PN (program numbers) are released):

This level is preset in the delivery state and contains the complete functional range of the device. The functions that are available in this level are designed for a further parameterisation in the standard settings.

The programming level is needed for complex applications, like e.g. the linkage of alarms, supporting point treatment, totaliser functions, etc..

Which program numbers are available in the simple servicing level and which are available in the professional servicing level is shown in chapter 8.1 „Program number table“, in column „Servicing level“.

Attention should be paid to the following aspect:

For some program numbers, only the mostly used options are available in the simple servicing level (e.g. PNO Input signal).

Setpoints / Relays PN59 to PN97

You can influence the behaviour of the setpoints with various program numbers. The figures refer to the scaled measurement and are updated with the set measuring time. A description of the various parameters is given in chapter 6.2. Setpoints / Relays.

Linearization PN100 to PN130

Through the linearization, the user has the possibility to linearize a non-linear sensor signal. A detailed description can be found in chapter 8 on linearization PN100 \geq 0.

Totaliser / summation function PN180

For the add of measuring values, 3 operation types are available:

PN180=0 Without summation function, the sum value is preallocated with „0“ and does not change any more

PN180=1 Without permanent storage e.g. for dose procedures < 30 min the sum value is not stored in the devices memory, it could be damaged by being set back too often. In case of power failure all data get lost.

PN180=2 Permanent storage e.g. for the survey of quantities or distances or for longer spaces of time > 1h. Here a data loss in case of a power failure is avoided.

Totaliser calculation PN181, PN182 and PN183

To calculate a totaliser/sum value the time base and the unit are very important. The discharge is stated in amount per time and the speed in distance per time.

By parameterisation of the time base PN181 to s, min or h the device adds up the die totaliser value. If e.g. a sensors collects 1.200l/h, you only have to add up the 3.600th part of the total amount of liter at a measuring time of 1 second; in this case it would be 0.333 liter per measuring cycle.

Despite of this small value, the totaliser value can add up itself to a quite high value during a period of one year. In this example it would be approx. 10,512,000 liter in a year. Here, a declaration in cubic metres would be reasonable. For the realization of this, you have to preset a factor, in this example PN182=3 (10 3), so the value can be divided and liters become cubic metres.

If you want to integrate the amount for only one month, the demonstration in cubic metres can be provided with a decimal place under PN183.

If you parameterise now factor PN182=2 and the decimal place PN183=1, it would lead to a demonstration of 864.0 cubic metres at the end of the month.

Totaliser reset PN184, PN185

According to the demanded application the totaliser/sum value needs to be set back to a special point of time. This can be done directly by a parameterisation of the initial value PN184 on zero or by the under PN185 parameterised actuators (see program number table chapter 8.1). The most reasonable way is by the digital input, as it is not easy accessible for the operating personal.

Recall of the totaliser values PN186

The totaliser/sum value can be permanently or displayed by an actuator (zero key / digital input). Often the sum value has not the first priority, so its demonstration occurs as a coproduct.

Serial number PN200

Under PN200 you can call up the 5-digit serial number that allows allocation to the production process and the manufacturing procedure.

4.1 Program table

The program table lists all the program numbers (PN) with their function, range of values, default values, user level and servicing level.

PN	Function	Range of values	De- fault	User level	Servicing level
Channel 1					
0	<p>Measuring input</p> <p>Parameters 1 to 29 make use of the factory calibration.</p> <p>At PN0 = 1-12 set points can be changed in the measuring range.</p> <div style="border: 1px solid black; padding: 5px; margin: 10px 0;"> <p>ATTENTION! Only use 03 = ±10V or 04 = ±5V !</p> </div> <p>The parameters ≥ 30 need sensor calibration.</p>	<p>Current, voltage</p> <p>01 = 0...20 mA 02 = 4...20 mA 03 = 0...10 V 04 = 0...5 V</p> <p>05 = 0...2500 mV 06 = 0...1250 mV 07 = 0...600 mV 08 = 0...300 mV 09 = 0...150 mV 10 = 0...75 mV 11 = 0...35 mV 12 = 0...18 mV</p> <p>Temperature measurement</p> <p>13 = Pt100 (4/2 wire) 14 = Pt100 (3 wire) 15 = Pt200 (4/2 wire) 16 = Pt200 (3 wire) 17 = Pt500 (4/2 wire) 18 = Pt500 (3 wire) 19 = Pt1000 (4/2 wire) 20 = Pt1000 (3 wire) 21 = L 22 = J 23 = K 24 = B 25 = S 26 = N 27 = E 28 = T 29 = R</p> <p>Resistance / Potentiometer</p> <p>30 = ≤ 100 Ω (4/2 wire) 31 = ≤ 1 kΩ (4/2 wire) 32 = ≤ 10 kΩ (4/2 wire) 33 = 0/4...20 mA 34 = -1...10 V 35 = -1...5 V 36 = -500...2500 mV 37 = -500...1250 mV 38 = -500...600 mV 39 = ± 300 mV 40 = ± 150 mV</p>	3	2	1 (01..04, 13, 14, 19, 20, 22, 23) 2 (rest)

PN	Function	Range of values	De-fault	User level	Servicing level
0	Measuring input (continued)	Sensor calibration 40 = ± 150 mV 41 = ± 75 mV 42 = ± 35 mV 43 = ± 18 mV 44 = 0...5 mA 45 = 0...2 mA			
1	Final value / Fullscale PN0 ≤ 12 or PN0 ≥ 30	-9999...99999	1000 0	2	1
2	Zero point / Offset PN0 ≤ 12 and PN0 ≥ 30	-9999...99999	0	2	1
3	Decimal point Voltage, current With PN0 ≤ 12 and PN0 ≥ 30 Ptxxx resistance thermometer Physical unit and number after the decimal point; with PN0 = 13 to 20 0 or 1: the physical unit is not shown in the display 2 to 5: the unit is shown after the figure Thermocouple Physical unit and number after the decimal point; PN0 = 21 to 29 0 or 1: the physical unit is not shown in the display	00000...0.0000 0 = 8888.8 [°C] 1 = 8888.8 [°F] 2 = 8888°C [°C] 3 = 8888°F [°F] 4 = 888.8°C [°C] (-99.9...999.9) 5 = 888.8°F [°F] (-99.9...999.9) 0 = 8888.8 [°C] 1 = 8888.8 [°F] 2 = 8888°C [°C] 3 = 8888°F [°F]	none 2	2 2	1 2
5	Offset shift At analogue or resistance measurements and sensor calibration PN0 = 1 to 12 or 30 to 45, with temperature sensors, PN0 = 13 to 29	-9999...99999 Measuring range	0 0 / 0.0	2 2	2 2
6	With PN0 = 21 to 29 thermocouple reference junction (can only be parameterised with thermocouples)	0 = inactive 1 = active	1	2	2
7	Setpoints for taring	-9999...99999	0	2	2

PN	Function	Range of values	De- fault	User level	Servicing level
8	Activator for taring	0 = none 1 = digital input 2 = zero key 3 = digital input without key 4 = boot-up 5 = combination 1 with 4 6 = combination 2 with 4 7 = combination 3 with 4 8 = temporarily taring via digital input 9 = fast taring on digital input 10 = fast taring on zero key 11 = fast taring on digital input or zero key		2	2
General settings					
12	Sliding average value	0 = off 1...100 measuring values	0	2	2
13	Display time	0.1...10.0	1.0	2	2
14	Measuring time Voltage, current PN0 = 1...12; 33...45 Ptxxx 2/4 wire Ptxxx 3 wire Temperature measurement thermocouple Resistance 2/4 wire Resistance 3 wire	always set to 0.02 0.04...10.00 0.06...10.00 0.04...10.00 0.04...10.00 0.06...10.00	1.0 1.0 1.0 1.0 1.00 1.00	2 2 2 2 2 2	2
15	Display mode	1 = instantaneous value 2 = MIN value 3 = MAX value 4 = HOLD value 5 = sliding average value 6 = totaliser value 7 = absolute value 8 = trigger mode	1	2	2
16	Activator for MIN/MAX value reset	0 = no reset activator 1 = digital input 2 = zero key 3 = digital input or zero key 4 = with taring function	2	2	2
18	Zero point suppression	0...99999	0	4	2
19	Display brightness	0...9 (0 = bright / 9 = dark)	3	8	2

PN	Function	Range of values	De-fault	User level	Servicing level
Analogue output (Option)					
20	Final value / Fullscale	-9999...99999	10000	4	2
21	Initial value / Offset	-9999...99999	0	4	2
22	Analog output	0 = deactivated 1 = instantaneous value 2 = MIN value 3 = MAX value 4 = HOLD value 5 = sliding average value 6 = totaliser value 7 = absolute value	1	4	2
23	Signal selection	0 = 0-10 V 1 = 0-20 mA 2 = 4-20 mA	2	4	1
Interface					
34	Interface behaviour	0 = standard operation 1 = transmission operation	0	4	2
Security settings					
50	Programming lock	0000...9999	0000	8	2
51	Authorization code	0000...9999	0000	0	2
52	User level	0...8	8	0	1
Servicing level					
53	Simple servicing level Professional servicing level	1 = limited programming 2 = all PN (program numbers) are released	2	2	2
Flashing of the LED display					
59	Display flashing (approx. 0.5 seconds) No flashing Flashing at set point 1 Flashing at set point 2 Flashing at set point 3 Flashing at set point 4 Flashing at set point 1 and 2 Flashing at set point 3 and 4 Flashing at set point 1, 2, 3 and 4	0 = no flashing 1 = flashes at 1 2 = flashes at 2 3 = flashes at 3 4 = flashes at 4 5 = flashes at 1 and 2 6 = flashes at 3 and 4 7 = flashes at 1, 2, 3 & 4	0	6	2

PN	Function	Range of values	De- fault	User level	Servicing level
Setpoint 1					
60	Setpoint 1 (Source / Trigger value)	0 = not activated 1 = instantaneous value 2 = MIN value 3 = MAX value 4 = HOLD value 5 = sliding average value 6 = totaliser value 7 = absolute value	1	6	1
61	Threshold	-9999...99999	1000	6	1
62	Hysteresis	1...99999	1	6	1
63	Active above / below SP value	0 = active below SP 1 = active above SP	1	6	1
64	Switch delay	0.0...10.0 seconds	0.0	6	1
65	Delay type	0 = none 1 = switch-on delay 2 = switch-off delay 3 = switch-on/-off delay 4 = suppression with activated digital input	1	6	1
67	Setpoint confirmation	0 = no locking 1 = switch-off locking by zero key 2 = switch-off locking by external input 3 = switch-off locking by both 4 = no locking 5 = switch-on locking by zero key 6 = switch-on locking by digital input 7 = switch-on locking by both	0	6	2

PN	Function	Range of values	De-fault	User level	Servicing level
Setpoint 2					
70	Setpoint 2 (Source / Trigger value)	0 = not activated 1 = instantaneous value 2 = MIN value 3 = MAX value 4 = HOLD value 5 = sliding average value 6 = totaliser value 7 = absolute value	1	6	1
71	Threshold	-9999...99999	1000	6	1
72	Hysteresis	1...99999	1	6	1
73	Active above / below SP value	0 = active below SP 1 = active above SP	1	6	1
74	Switch delay	0.0...10.0 seconds	0.0	6	1
75	Delay type	0 = none 1 = switch-on delay 2 = switch-off delay 3 = switch-on / -off delay 4 = suppression with activated digital input	1	6	1
77	Setpoint confirmation	0 = no locking 1 = switch-off locking by zero key 2 = switch-off locking by external input 3 = switch-off locking by both 4 = no locking 5 = switch-on locking by zero key 6 = switch-on locking by digital input 7 = switch-on locking by both	0	6	2

PN	Function	Range of values	De- fault	User level	Servicing level
Setpoint 3					
80	Setpoint 3 (Source / Trigger value)	0 = not activated 1 = instantaneous value 2 = MIN value 3 = MAX value 4 = HOLD value 5 = sliding average value 6 = totaliser value 7 = absolute value	1	6	1
81	Threshold	-9999...99999	1000	6	1
82	Hysteresis	1...99999	1	6	1
83	Active above / below SP value	0 = active below SP 1 = active above SP	1	6	1
84	Switch delay	0.0...10.0 seconds	0,0	6	1
85	Delay type	0 = none 1 = switch-on delay 2 = switch-off delay 3 = switch-on /-off delay 4 = suppression with activated digital input	1	6	1
87	Setpoint confirmation	0 = no locking 1 = switch-off locking by zero key 2 = switch-off locking by external input 3 = switch-off locking by both 4 = no locking 5 = switch-on locking by zero key 6 = switch-on locking by digital input 7 = switch-on locking by both	0	6	2

PN	Function	Range of values	De- fault	User level	Servicing level
Setpoint 4					
90	Setpoint 4 (Source / Trigger value)	0 = not activated 1 = instantaneous value 2 = MIN value 3 = MAX value 4 = HOLD value 5 = sliding average value 6 = totaliser value 7 = absolute value	1	6	1
91	Threshold	-9999...99999	1000	6	1
92	Hysteresis	1...99999	1	6	1
93	Active above / below SP value	0 = active below SP 1 = active above SP	1	6	1
94	Switch delay	0.0...10.0 seconds	0,0	6	1
95	Delay type	0 = none 1 = switch-on delay 2 = switch-off delay 3 = switch-on / -off delay 4 = suppression with activated digital input	1	6	1
97	Setpoint confirmation	0 = no locking 1 = switch-off locking by zero key 2 = switch-off locking by external input 3 = switch-off locking by both 4 = no locking 5 = switch-on locking by zero key 6 = switch-on locking by digital input 7 = switch-on locking by both	0	6	2

PN	Function	Range of values	De-fault	User level	Servicing level
Linearization					
100	Number of additional setpoints	0...30	0	2	2
101 ... 130	Setpoints 1...30	-9999...99999		2	2
180	Totaliser function	0 = off 1 = totaliser without permanent saving (Reset by boot-up) 2 = totaliser with permant saving	0	3	2
181	Time base of display value for totalizator function	0 = second 1 = minute 2 = hour	0	3	2
182	Factor for totalizer value in powers of 10	0 = 1...6 = 1.000.000	0	3	2
183	Decimal point for totaliser value	00000...0,0000	0	3	2
184	Counter value in digit (for Reset through 0, too), inital value aswell	0...99999	0	3	2
185	Activator for counter reset on 0 (Zero key or digital input: push for at least 50 ms)	0 = no reset source 1 = by zero key 2 = by external input 3 = by zero key and digital input 4 = UP and DOWN while showing totaliser value	0	3	2
186	Change display on totaliser value	0 = no change 1 = by zero key 2 = by digital input	0	3	2
Information					
200	Serial number	0...99999	0	8	2

5. ERROR ELIMINATION

The following list gives the recommended procedure for dealing with faults and locating their possible cause.

	Error description	Measures
1.	The unit permanently indicates overflow.	<ul style="list-style-type: none"> • The input has a very high measurement, check the measuring circuit. • With a selected input with a low voltage signal, it is only connected on one side or the input is open. • Not all of the activated setpoints are parameterised. Check if the relevant parameter PN1, PN2, PN100...PN130 are adjusted correctly.
2.	The unit permanently shows underflow.	<ul style="list-style-type: none"> • The input has a very low measurement, check the measuring circuit . • With a selected input with a low voltage signal, it is only connected on one side or the input is open. • Not all of the activated setpoints are parameterised. Check if the relevant parameter PN1, PN2, PN100...PN130 are adjusted correctly.
3.	The word <i>HELP</i> lights up in the 7-segment display.	<ul style="list-style-type: none"> • The unit has found an error in the configuration memory. Perform a reset on the default values and reconfigure the unit according to your application.
4.	Program numbers for parameterising of the input are not accessible.	<ul style="list-style-type: none"> • The programming lock is set at a user level that does not allow access. • Under PN1, a different sensor type was parameterised so that the desired program number cannot be parameterised.
5.	<i>ERR1</i> lights up in the 7-segment display.	<ul style="list-style-type: none"> • Please contact the manufacturer if errors of this kind occur.
6.	The addressed digital input does not react.	<ul style="list-style-type: none"> • Measure the current of the digital input with a multimeter. It should be between 1 mA and 3 mA.
7.	Program numbers for the analog output PN20...PN23 are not accessible.	<ul style="list-style-type: none"> • The analog output is an option of this device type. If it is not assembled, then the program numbers are not shown.
8.	The device does not react as expected.	<ul style="list-style-type: none"> • If you are not sure if the device has been parameterised before, then follow the steps as written in the next chapter and set it back to its delivery status.

RESET TO DEFAULT VALUES

To return the unit to a defined basic state, a reset can be carried out to the default values.

The following procedure should be used:

- Switch off the power supply
- Press button [P]
- Switch on the power supply and press [P] for approx. further 2 seconds.

With reset, the default values of the program table are loaded and used for subsequent operation. This puts the unit back to the state in which it was supplied.

 
Caution!

- This is only possible when the programming lock PN50 allows access to all PNs or *HELP* is shown in the display.
- All application-related data are lost.

6. Appendix - Non-standard variations: pin assignment

ValueView-S-02

Sub-D Plug (male) 9-pin




(view of the plug contacts)

Pin	Connections Sub D 9-pin
1	NC
2	RXD
3	TXD
4	NC
5	GND
6	NC
7	NC
8	NC
9	NC

ValueView-S-03

 Sub-D Plug (male) 12-pin



Sicht auf die Steckkontakte

(view of the plug contacts)


Contact rating: max 30V DC/AC 1A

Pin	Connections Sub D 25-pin
1	NCC opening contact
2	NOC closing contact
3	Change over contact
4	NCC opening contact
5	NOC closing contact
6	Change over contact
7	NCC opening contact
8	NOC closing contact
9	Change over contact
10	NCC opening contact
11	NOC closing contact
12	Change over contact
13-25	NC

Variations that deviate from the standard: **pin assignment**

ValueView-S-07


7-pin round socket

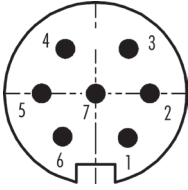

(coupling socket - female - seen from the front)

Pin	Assignment S-07
1	speed output (looped through)
2	+12V
3	ground speed
4	torque current output 0/4 - 20 mA
5	torque ground current output
6	control input
7	taring

Torque analog output, direct output from torque sensor, untared.

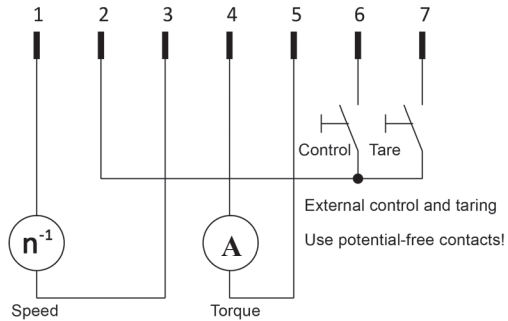


6. APPENDIX - Non-Standard Variations: **device properties**

Device Properties

ValueView-S-05

Switchover of the supply voltage of the torque sensor

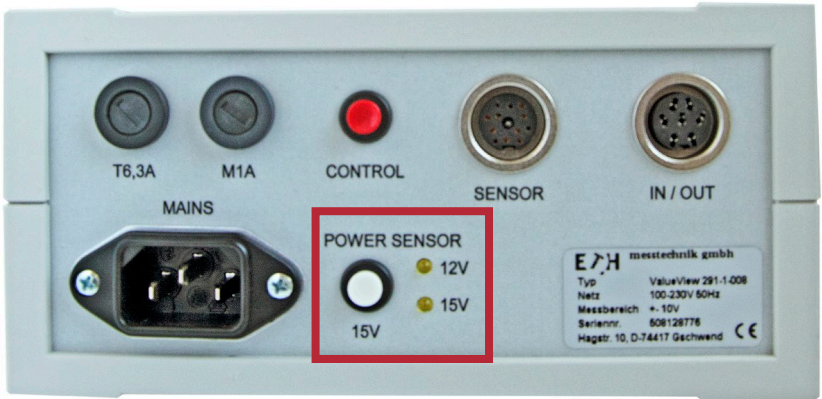

7. OPERATING INSTRUCTIONS FOR THE SPECIAL VERSION S286

Important note

The following instructions are based on the operating instructions for the standard version "PU5 panel meter with multi-functional measuring input".

They explain the additional functions of the special version, S286.

For safety instructions and connecting possibilities, please consult the standard operating instructions.

7.1 Description of functions

The functions of the unit have been extended as follows:

- optional permanent display of minimum or maximum values
- minimum or maximum value reset via digital input or fourth key
- hold function with statically activated digital input
- automated taring function via digital input or fourth key
- measuring input range +/- full-scale for 10 V, 5 V, 20 mA input

On initialisation, the display shows "Fu.286" for 1 second and then the software version code. For the functions shown here, the version should be at least "U1.12".

7.1.1 Permanent display of minimum or maximum values PN15

The unit supports several operating modes of the digital display that can be selected via the program number PN15.

7.1.2 Instantaneous value (PN15 = 1)

The "instantaneous value" operating mode corresponds to the standard display, with the last measured value appearing in the display.

7.1.3 Display of minimum value (PN15 = 2)

In the "minimum value" operating mode, the lowest displayed value since the last minimum value reset is displayed. The minimum value reset is performed on starting up the system (when switching on) or optionally via the digital input (fourth key).

7.1.4 Display of maximum value (PN15 = 3)

In the "maximum display" operating mode, the highest displayed value since the last maximum value reset is displayed. The maximum value reset is performed on starting up the system (when switching on) or optionally via the digital input (fourth key).

7.1.5 Hold value display (PN15 = 4)

In the "hold display" operating mode, the last recorded measurement (based on the measuring time PN14) is shown in the display. With a slower display cycle time (PN13), the value may therefore jump again on triggering the digital input.

7.1.6 Minimum/maximum value reset PN16

After the system has started, the minimum and maximum values are automatically reset to the current value. Three additional triggering mechanisms are available to reset the minimum and maximum values during operation.

The value reset is signaled by 5 bars („-----“) for 0.5 seconds shortly after pressing the digital input or the fourth button. The instantaneous value is then displayed in the minimum value display or maximum value display operating mode until the trigger is withdrawn. In this way, the instantaneous value can be observed over a longer period of time.

If the value reset is to be carried out during taring, there is no message about this on the display. The minimum or maximum value reset is only carried out once shortly after taring.

With a value reset, only the minimum or maximum value currently visible in the display is reset!

PN 16 =	Trigger for minimum/maximum value reset
0	none
1	digital input active longer than 50 ms
2	fourth button pressed longer than 50 ms
3	digital input or 4th button active for longer than 50 ms
4	on taring

7.1.7 Taring PN8

During taring, the instantaneous value of the display is set to a specified setpoint, which can be configured under PN7. The difference between the setpoint and the actual value is stored in the device as an offset (PN 5). The taring recognizes the following operating modes, which can be set under PN8:

The taring can be undone by programming the program number 5 to the value zero.

Taring at PN8 = 8 is a special form. Here the taring is not saved in program number 5, but only calculated temporarily for the duration of the activated digital input. The old tare value is lost when the system is started.

PN 8 =	Trigger for minimum/maximum value reset
0	none
1	Digital input active for more than 3 seconds
2	Fourth button pressed longer than 3 seconds
3	Digital input or fourth button active for more than 3 seconds
4	Taring at system start
5	Taring at system start and at digital input
6	Taring at system start and at 4th button
7	Taring at system start, digital input and 4th button
8	Taring with activated digital input for activation period

As an acknowledgment for the taring, „00000“ is shown on the display for at least 1 second. Taring is only carried out once, after 3 seconds of pressing the digital input or the fourth button. For a new adjustment, the signal must first be withdrawn.

If the minimum/maximum value reset is programmed to the same trigger as the taring, a minimum/maximum value reset also takes place during the taring. This makes it easy to monitor taring, as you can read the instantaneous value before and after taring.

7.1.8 Allocation of the values to the outputs PN22, 60, 70, 80 and 90

As it is not always desired that the outputs follow the operating mode, the outputs can also be assigned to the minimum/maximum value. For this purpose, the adjustable value range of the corresponding program numbers (PN22, PN60, PN70, PN80 and PN90) is extended as follows:

7.1.9 Suppressing the relay output PN65, 75, 85 and 95

Mode	Source / control value
0	None
1	current value
2	minimum value
3	maximum value
4	hold value

The delay type (PN65, 75, 85, 95) of the switching points is extended by one point. The activation of the threshold (depending on the operating principle) is suppressed (delayed) when the digital input is activated at the same time.

Mode	delay type
0	None
1	switch-on delay
2	switch-off delay
3	switch on and off delay
4	suppression with activated digital input

7.1.10 Hold function

The hold function is permanently activated. When the digital input is deactivated, the hold value temporarily stored in the device is permanently overwritten when the measured value is recorded. If the digital input is activated, the temporary storage of the hold value is interrupted and the last measured value stored is retained. The hold value is lost when the device is restarted!

7.1.11 +/- full scale measurement inputs

The voltage and current signals can also be measured in the negative full scale range.

Attention! The measuring ranges PNO = 32 (10 kOhm) and PNO = 19/20 (PT1000) can only be used to a limited extent!

7.2 Program number table special software

General overview of the program number table of the special software:

PN	Function	Range of values	De- fault	User- level
Channel 1				
0	Measuring input	see normal operating instructions	3	2
1	Fullscale PN0 ≤ 12 or PN0 ≥ 29	-9999...99999	10000	2
2	Offset PN0 ≤ 12 and PN0 ≥ 29	-9999...99999	0	2
3	Decimal point Voltage / current With PN0 ≤ 12 and PN0 ≥ 26 PTxxx resistance thermometer Physical unit and number after the decimal point; with PN0 = 13 to 20 0 or 1: the physical unit is not shown in the display 2 to 5: the unit is shown after the figure Thermocouple Physical unit and number after the decimal point; PN0 = 21 to 29 0 or 1: the physical unit is not shown in the display 2 or 3: the unit is given after the figure	00000...0,0000 0 = 8888.8 [°C] 1 = 8888.8 [°F] 2 = 8888°C [°C] 3 = 8888°F [°F] 4 = 888.8°C [°C] (-99.9...850.0) 5 = 888.8°C [°F] (-99.9...999.9) 0 = 8888.8 [°C] 1 = 8888.8 [°F] 2 = 8888°C [°C] 3 = 8888°F [°F]	none 2 0	2 2 2
5	Offset shift At analogue or resistance measurements and sensor calibration PN0 = 1 to 12 or 30 to 45; With temperature sensors, PN0 = 13 to 29	-9999...99999 Measuring range	0 0,0 / 0,00	2 2
6	With PN0 = 21 to 29 thermocouple reference junction (can only be parameterised with thermocouples)	0 = deactiv 1 = activ	1	2
7	Target value for taring	-9999...99999	0	2

8	Trigger for taring	0 = none 1 = digital input 2 = fourth key 3 = digital input or key 4 = system start-up 5 = combination 1 with 4 6 = combination 2 with 4 7 = combination 3 with 4 8 = partial taring via digital input	0	2
General settings				
13	Display time	0.1 ... 10.0	1,0	2
14	Measuring time (in 0.02 seconds-steps) Voltage, current PN0 = 1...12; 33...45 PTxxxx 2/4 wire PTxxxx 3 wire Temperature measurement thermocouple	0.02...10.00 0.04...10.00 0.06...10.00 0.04...10.00	1,00 1,00 1,00 1,00	2 2 2 2
	Resistance 2/4 wire Resistance 3 wire	0.04...10.00 0.06...10.00	1,00 1,00	2 2
15	Display mode	0 = deactivated 1 = instantaneous value 2 = minimal value 3 = maximum value	1	2
16	Trigger for MIN/MAX value reset	0 = no reset trigger 1 = digital input 2 = fourth key 3 = digital input or fourth key 4 = on taring	2	2
18	Zero point suppression	0...99999	0	2
19	Display brightness	0...9 (0=bright / 9=dark)	3	8
Analogue output				
20	Fullscale (option)	-9999...99999	10000	4
21	Offset (option)	-9999...99999	0	4
22	Analogue output (source / control value)	0 = deactivated 1 = instantaneous value 2 = minimal value 3 = maximum value 4 = hold value	1	4
Interface				
34	Interface behaviour	0 = standard operation 1 = transmission operation	0	4
Security settings				
50	Programming lock	0000...9999	0000	8
51	Authorisation code	0000...9999	0000	8
52	Userlevel	0...8	0	0

Flashing of the LED display				
59	Display flashing (approx. 0.5 seconds) no flashing Flashing at setpoint 1 Flashing at setpoint 2 Flashing at setpoint 3 Flashing at setpoint 4 Flashing at setpoint 1 and 2 Flashing at setpoint 3 and 4 Flashing at setpoint 1, 2, 3 and 4	0 no flashing 1 flashes with 1 st 2 flashes with 2 nd 3 flashes with 3 rd 4 flashes with 4 th 5 flashes with 1 st and 2 nd 6 flashes with 3 rd and 4 th 7 flashes with 1 st , 2 nd , 3 rd and 4 th	0	6
Setpoint 1				
60	Setpoint 1 (source / control value)	0 = deactivated 1 = instantaneous value 2 = minimal value 3 = maximum value 4 = hold value	1	6
61	Threshold	-9999...99999	1000	6
62	Hysteresis	1...99999	1	6
63	Active above / below SP value	0 = active below SP 1 = active above SP	0	6
64	Switch delay	0.0...10.0 seconds	0.0	6
65	Delay type	0 none 1 switch-on delay 2 switch-off delay 3 switch-on/off delay 4 = suppression with activated digital input	1	6
Setpoint 2				
70	Setpoint 2 (source / control value)	0 = deactivated 1 = instantaneous value 2 = minimal value 3 = maximum value 4 = hold value	1	6
71	Threshold	-9999...99999	1000	6
72	Hysteresis	1...99999	1	6
73	Active above / below SP value	0 = active below SP 1 = active above SP	0	6
74	Switch delay	0.0...10.0 seconds	0.0	6
75	Delay type	0 none 1 switch-on delay 2 switch-off delay 3 switch-on/off delay 4 = suppression with activated digital input	1	6

Setpoint 3				
80	Setpoint 1 (source / control value)	0 = deactivated 1 = instantaneous value 2 = minimal value 3 = maximum value 4 = hold value	1	6
81	Threshold	-9999...99999	1000	6
82	Hysteresis	1...99999	1	6
83	Active above / below SP value	0 = active below SP 1 = active above SP	0	6
84	Switch delay	0.0...10.0 seconds	0.0	6
85	Delay type	0 none 1 switch-on delay 2 switch-off delay 3 switch-on/off delay 4 = suppression with activated digital input	1	6
Setpoint 4				
90	Setpoint 1 (source / control value)	0 = deactivated 1 = instantaneous value 2 = minimal value 3 = maximum value 4 = hold value	1	6
91	Threshold	-9999...99999	1000	6
92	Hysteresis	1...99999	1	6
93	Active above / below SP value	0 = active below SP 1 = active above SP	0	6
94	Switch delay	0.0...10.0 seconds	0,0	6
95	Delay type	0 none 1 switch-on delay 2 switch-off delay 3 switch-on/off delay 4 = suppression with activated digital input	1	6
Linearisation				
100	Number of additional calibration points	0...30	0	2
101... 130	Calibration points 1...30	-9999...99999		2
Information				
200	Serial number	0...99999	0	8



hagstrasse 10
D-74417 gschwend
tel. +49 (0) 79 72 / 93 10 - 0
fax +49 (0) 79 72 / 93 10 - 50
sales@eth-messtechnik.de
www.eth-messtechnik.de